
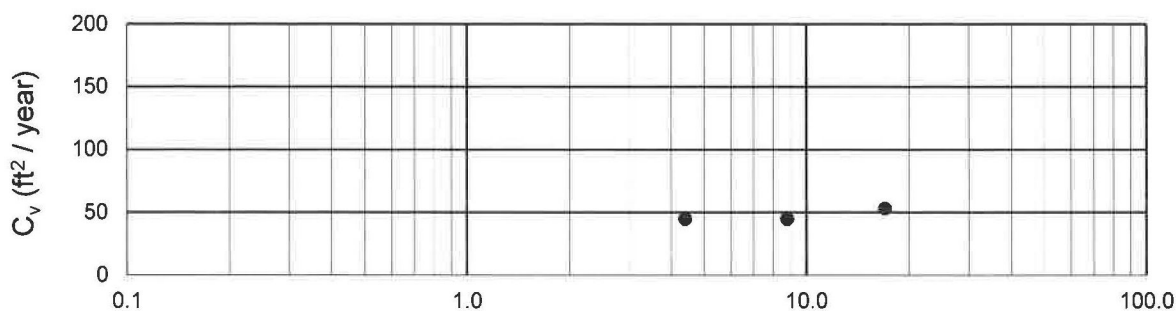


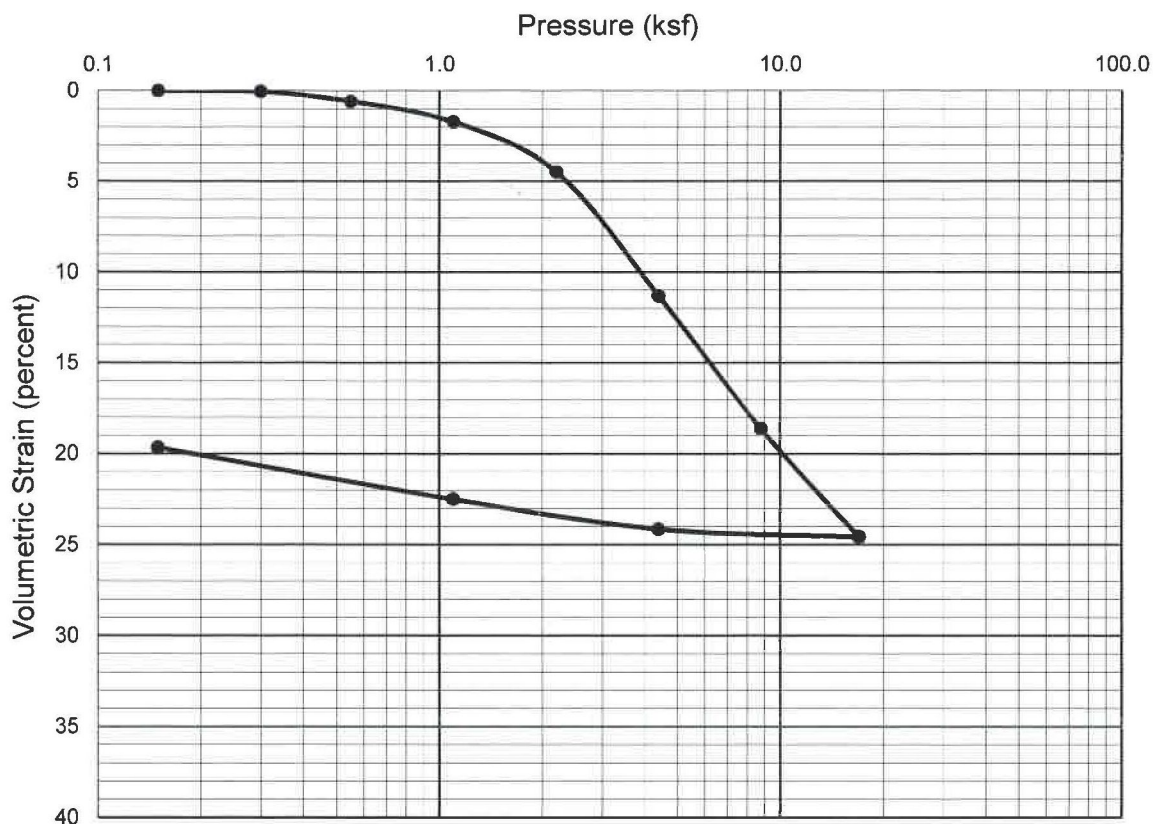

Sampler Type: Shelby Tube				Condition	Before Test		After Test	
Diameter (in)	2.41	Height (in)	1.00	Water Content	w _o	50.9 %	w _f	35.9 %
Overburden Pressure, p _o		1,600	psf	Void Ratio	e _o	1.39	e _f	0.97
Preconsol. Pressure, p _c		2,000	psf	Saturation	S _o	99 %	S _f	100 %
Compression Ratio, C _{ec}		0.25		Dry Density	γ _d	71 pcf	γ _d	86 pcf
LL	--	PL	--	PI	--	G _s	2.70	(assumed)
Classification CLAY (CH), gray				Source B32-3 at 24 feet				

BLOCKS 29-32
MISSION BAY
 San Francisco, California
Treadwell & Rollo
A LANBAN COMPANY

CONSOLIDATION TEST REPORT

Date 11/11/11 Project No. 750603902 Figure C-18